



[4910-13-P]

DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2015-7530; Directorate Identifier 2014-NM-257-AD]

RIN 2120-AA64

Airworthiness Directives; Fokker Services B.V. Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: We propose to adopt a new airworthiness directive (AD) for all Fokker Services B.V. Model F.28 Mark 0070 and 0100 airplanes. This proposed AD was prompted by a report of cracking in a certain section of the secondary structure of the wing. This proposed AD would require a one-time inspection of the trailing edge rib, and corrective action if necessary. We are proposing this AD to detect and correct cracking that could lead to failure of the affected rib and consequent reduced control of the airplane.

DATES: We must receive comments on this proposed AD by [INSERT DATE 45 DAYS AFTER DATE OF PUBLICATION IN THE FEDERAL REGISTER].

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- Federal eRulemaking Portal: Go to <http://www.regulations.gov>. Follow the instructions for submitting comments.

- Fax: 202-493-2251.

- Mail: U.S. Department of Transportation, Docket Operations, M-30,
West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE.,
Washington, DC 20590.

- Hand Delivery: U.S. Department of Transportation, Docket Operations, M-30,
West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE.,
Washington, DC, between 9 a.m. and 5 p.m., Monday through Friday, except Federal
holidays.

For service information identified in this proposed AD, contact Fokker Services B.V., Technical Services Dept., P.O. Box 1357, 2130 EL Hoofddorp, the Netherlands; telephone +31 (0)88-6280-350; fax +31 (0)88-6280-111; email technicalservices@fokker.com; Internet <http://www.myfokkerfleet.com>. You may view this referenced service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Examining the AD Docket

You may examine the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-7530; or in person at the Docket Management Facility between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this proposed AD, the regulatory evaluation, any comments received, and other information. The street address for the Docket Operations

office (telephone 800-647-5527) is in the ADDRESSES section. Comments will be available in the AD docket shortly after receipt.

FOR FURTHER INFORMATION CONTACT: Tom Rodriguez, Aerospace Engineer, ANM 116, Transport Airplane Directorate, FAA, 1601 Lind Avenue SW., Renton, WA 98057-3356; telephone 425-227-1137; fax 425-227-1139.

SUPPLEMENTARY INFORMATION:

Comments Invited

We invite you to send any written relevant data, views, or arguments about this proposed AD. Send your comments to an address listed under the ADDRESSES section. Include “Docket No. FAA-2015-7530; Directorate Identifier 2014-NM-257-AD” at the beginning of your comments. We specifically invite comments on the overall regulatory, economic, environmental, and energy aspects of this proposed AD. We will consider all comments received by the closing date and may amend this proposed AD based on those comments.

We will post all comments we receive, without change, to <http://www.regulations.gov>, including any personal information you provide. We will also post a report summarizing each substantive verbal contact we receive about this proposed AD.

Discussion

The European Aviation Safety Agency (EASA), which is the Technical Agent for the Member States of the European Union, has issued EASA Airworthiness Directive 2014-0271, dated December 12, 2014 (referred to after this as the Mandatory Continuing

Airworthiness Information, or “the MCAI”), to correct an unsafe condition for all Fokker Services B.V. Model F.28 Mark 0070 and 0100 airplanes. The MCAI states:

Service experience with the Fokker 100 type design has shown that cracking can occur in the secondary structure of the wing at station 8700, rib Part Number (P/N) D15445-013/-014 (or lower dash number) in the trailing edge section. The hydraulic actuator assembly, hydraulic lines, the cable pulleys, the anti-upfloat quadrant and the associated mechanical linkages including flutter dampers are all positioned in the affected area, between wing stations 8200 and 9270.

This condition, if not detected and corrected, could lead to failure of the affected rib, possibly resulting in reduced control of the aeroplane.

To address this potential unsafe condition, Fokker Services published Service Bulletin (SB) SBF100-57-048, which provides inspection instructions to detect any cracks in the affected area.

For the reasons described above, this AD requires a one-time [detailed] inspection of the trailing edge rib at wing station 8700 and, depending on findings, accomplishment of applicable corrective action(s).

This AD is considered to be an interim action and further AD action may follow, possibly to introduce new ALS [Airworthiness Limitations Section] tasks, if justified by the inspection results.

Corrective actions include repair of cracking in the secondary structure of the wing at station 8700, rib Part Number (P/N) D15445-013/-014 (or lower dash number), in the trailing edge section.

You may examine the MCAI in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-7530.

Related Service Information under 1 CFR part 51

We reviewed Fokker Service Bulletin SBF100-57-048, dated October 27, 2014. This service information describes procedures for inspecting the trailing edge section at the rib of wing station 8700 for cracking. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section of this NPRM.

FAA's Determination and Requirements of this Proposed AD

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to our bilateral agreement with the State of Design Authority, we have been notified of the unsafe condition described in the MCAI and service information referenced above. We are proposing this AD because we evaluated all pertinent information and determined an unsafe condition exists and is likely to exist or develop on other products of the same type designs.

Costs of Compliance

We estimate that this proposed AD affects 8 airplanes of U.S. registry.

We also estimate that it would take about 1 work-hour per product to comply with the basic requirements of this proposed AD. The average labor rate is \$85 per work-hour. Required parts would cost about \$0 per product. Based on these figures, we estimate the cost of this proposed AD on U.S. operators to be \$680, or \$85 per product.

We have received no definitive data that would enable us to provide cost estimates for the on-condition actions specified in this proposed AD.

Authority for this Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator.

“Subtitle VII: Aviation Programs,” describes in more detail the scope of the Agency’s authority.

We are issuing this rulemaking under the authority described in “Subtitle VII, Part A, Subpart III, Section 44701: General requirements.” Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

We determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

1. Is not a “significant regulatory action” under Executive Order 12866;
2. Is not a “significant rule” under the DOT Regulatory Policies and Procedures (44 FR 11034, February 26, 1979);
3. Will not affect intrastate aviation in Alaska; and
4. Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39 - AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. The FAA amends § 39.13 by adding the following new airworthiness directive (AD):

Fokker Services B.V. Airplanes: Docket No. FAA-2015-7530; Directorate Identifier 2014-NM-257-AD.

(a) Comments Due Date

We must receive comments by [INSERT DATE 45 DAYS AFTER DATE OF PUBLICATION IN THE FEDERAL REGISTER].

(b) Affected ADs

None.

(c) Applicability

This AD applies to all Fokker Services B.V. Model F.28 Mark 0070 and 0100 airplanes, certificated in any category.

(d) Subject

Air Transport Association (ATA) of America Code 57, Wings.

(e) Reason

This AD was prompted by report of cracking in the secondary structure of the wing at station 8700. We are issuing this AD to detect and correct cracking that could lead to failure of the affected rib and consequent reduced control of the airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Inspection

Within 12 months after the effective date of this AD, do a detailed inspection for cracking of the trailing edge rib at wing station 8700, in accordance with the Accomplishment Instructions of Fokker Service Bulletin SBF100-57-048, dated October 27, 2014. If any crack is found: Before further flight, repair using a method approved by the Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA; or the European Aviation Safety Agency (EASA); or Fokker Services B.V.'s EASA Design Organizational Authority (DOA).

(h) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) Alternative Methods of Compliance (AMOCs): The Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or local Flight Standards District Office, as appropriate. If sending information directly to the International Branch, send it to ATTN: Tom Rodriguez, Aerospace Engineer,

International Branch, ANM 116, Transport Airplane Directorate, FAA,
1601 Lind Avenue SW., Renton, WA 98057-3356; telephone 425-227-1405;
fax 425-227-1149. Information may be emailed to:

9-ANM-116-AMOC-REQUESTS@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the local flight standards district office/certificate holding district office. The AMOC approval letter must specifically reference this AD.

(2) Contacting the Manufacturer: For any requirement in this AD to obtain corrective actions from a manufacturer, the action must be accomplished using a method approved by the Manager, International Branch, ANM-116, Transport Airplane Directorate, FAA; or the European Aviation Safety Agency (EASA); or Fokker B.V. Service's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(i) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) European Airworthiness Directive 2014-0271, dated December 12, 2014, for related information. This MCAI may be found in the AD docket on the Internet at <http://www.regulations.gov> by searching for and locating Docket No. FAA-2015-7530.

(2) For service information identified in this AD, contact Fokker Services B.V., Technical Services Dept., P.O. Box 1357, 2130 EL Hoofddorp, the Netherlands; telephone +31 (0)88-6280-350; fax +31 (0)88-6280-111; email technicalservices@fokker.com; Internet <http://www.myfokkerfleet.com>. You may view this service information at the FAA, Transport Airplane Directorate, 1601 Lind Avenue SW., Renton, WA. For information on the availability of this material at the FAA, call 425-227-1221.

Issued in Renton, Washington, on December 11, 2015.

Michael Kaszycki,
Acting Manager,
Transport Airplane Directorate,
Aircraft Certification Service.

[FR Doc. 2015-32086 Filed: 12/23/2015 8:45 am; Publication Date: 12/24/2015]