



DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2021-0030; Project Identifier MCAI-2020-01395-T]

RIN 2120-AA64

Airworthiness Directives; Bombardier, Inc., Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: The FAA proposes to adopt a new airworthiness directive (AD) for certain Bombardier, Inc., Model BD-700-1A10 airplanes. This proposed AD was prompted by a report indicating that during installation, a fuel pipe bracket assembly on the intermediate rib in the center fuel tank was mislocated, resulting in an offset between the fitting assembly and the refuel/defuel tube assembly. This proposed AD would require modification of the fuel pipe bracket assembly, including all related investigative actions and corrective actions, if necessary; and performing an operational test of the refuel and defuel system. The FAA is proposing this AD to address the unsafe condition on these products.

DATES: The FAA must receive comments on this proposed AD by [INSERT DATE 45 DAYS AFTER DATE OF PUBLICATION IN THE FEDERAL REGISTER].

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- Federal eRulemaking Portal: Go to <https://www.regulations.gov>. Follow the instructions for submitting comments.
- Fax: 202-493-2251.
- Mail: U.S. Department of Transportation, Docket Operations, M-30, West

Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- Hand Delivery: Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

For service information identified in this NPRM, contact Bombardier, Inc., 400 Côte-Vertu Road West, Dorval, Québec H4S 1Y9, Canada; telephone 514-855-5000; fax 514-855-7401; email thd.crj@aero.bombardier.com; Internet <http://www.bombardier.com>. You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

Examining the AD Docket

You may examine the AD docket on the Internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2021-0030; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, any comments received, and other information. The street address for Docket Operations is listed above. Comments will be available in the AD docket shortly after receipt.

FOR FURTHER INFORMATION CONTACT: Siddeeq Bacchus, Aerospace Engineer, Mechanical Systems and Administrative Services Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7362; fax 516-794-5531; email 9-avs-nyaco-cos@faa.gov.

SUPPLEMENTARY INFORMATION:

Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments to an address listed under ADDRESSES. Include

“Docket No. FAA-2021-0030; Project Identifier MCAI-2020-01395-T” at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend the proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to <https://www.regulations.gov>, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this proposed AD.

Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as “PROPIN.” The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Siddeeq Bacchus, Aerospace Engineer, Mechanical Systems and Administrative Services Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7362; fax 516-794-5531; email 9-avs-nyaco-cos@faa.gov. Any commentary that the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

Discussion

Transport Canada Civil Aviation (TCCA), which is the aviation authority for Canada, has issued TCCA AD CF-2020-37, dated October 9, 2020 (referred to after this as the Mandatory Continuing Airworthiness Information, or the MCAI), to correct an unsafe condition for certain Bombardier, Inc., Model BD-700-1A10 airplanes. You may examine the MCAI in the AD docket on the Internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2021-0030.

This proposed AD was prompted by a report indicating that during installation, a fuel pipe bracket assembly on the intermediate rib in the center fuel tank was mislocated, resulting in an offset between the fitting assembly and the refuel/defuel tube assembly. The FAA is proposing this AD to address the offset, which could cause a preload on the fuel pipes and reduce their ability to absorb shock or vibration-induced loads, making the tube and clamp more prone to stress corrosion cracking. This could lead to failure of the coupling and the bracket and p-clamp assembly, resulting in fuel leakage and loss of electrical bonding between fuel pipes, and lightning-induced sparking that could induce fuel ignition. See the MCAI for additional background information.

Related Service Information under 1 CFR Part 51

Bombardier has issued Service Bulletin 700-28-6006, dated June 1, 2020. This service information describes procedures for a modification of the fuel pipe bracket assembly, including investigative actions (a detailed visual inspection of the fuel pipe assembly for any damaged paint, permanent deformation, corrosion, cracking, gouges, dents, or deep scratches); installation of certain new parts; replacement of the fuel pipe and fuel pipe bracket assembly, if necessary; and an operational test of the refuel and defuel system. This service information is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section.

FAA's Determination

This product has been approved by the aviation authority of another country, and is approved for operation in the United States. Pursuant to the FAA's bilateral agreement with the State of Design Authority, the FAA has been notified of the unsafe condition described in the MCAI and service information referenced above. The FAA is proposing this AD because the FAA evaluated all the relevant information and determined the unsafe condition described previously is likely to exist or develop on other products of the same type design.

Proposed Requirements of this NPRM

This proposed AD would require accomplishing the actions specified in the service information described previously.

Costs of Compliance

The FAA estimates that this proposed AD affects 51 airplanes of U.S. registry. The FAA estimates the following costs to comply with this proposed AD:

Estimated costs for required actions

Labor cost	Parts cost	Cost per product	Cost on U.S. operators
10 work-hours X \$85 per hour = \$850	\$904	\$1,754	\$89,454

The FAA estimates the following costs to do any necessary on-condition action that would be required based on the results of any required actions. The FAA has no way of determining the number of aircraft that might need this on-condition action:

Estimated costs of on-condition actions

Labor cost	Parts cost	Cost per product
3 work-hours X \$85 per hour = \$255	\$1,937	\$2,192

According to the manufacturer, some or all of the costs of this proposed AD may be covered under warranty, thereby reducing the cost impact on affected individuals. The

FAA does not control warranty coverage for affected individuals. As a result, the FAA has included all known costs in the cost estimate.

Authority for this Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national Government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a "significant regulatory action" under Executive Order 12866,
- (2) Will not affect intrastate aviation in Alaska, and
- (3) Will not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39 - AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. The FAA amends § 39.13 by adding the following new airworthiness directive:

Bombardier, Inc.: Docket No. FAA-2021-0030; Project Identifier
MCAI-2020-01395-T.

(a) Comments Due Date

The FAA must receive comments by [INSERT DATE 45 DAYS AFTER DATE OF PUBLICATION IN THE FEDERAL REGISTER].

(b) Affected Airworthiness Directives (ADs)

None.

(c) Applicability

This AD applies to Bombardier, Inc., Model BD-700-1A10 airplanes, certificated in any category, serial numbers 9657 through 9844 inclusive.

(d) Subject

Air Transport Association (ATA) of America Code 28, Fuel.

(e) Reason

This AD was prompted by a report indicating that during installation, a fuel pipe bracket assembly on the intermediate rib in the center fuel tank was mislocated, resulting in an offset between the fitting assembly and the refuel/defuel tube assembly. The FAA is issuing this AD to address the offset, which could cause a preload on the fuel pipes and

reduce their ability to absorb shock or vibration-induced loads, making the tube and clamp more prone to stress corrosion cracking. This could lead to failure of the coupling and the bracket and p-clamp assembly, resulting in fuel leakage and loss of electrical bonding between fuel pipes, and lightning-induced sparking that could induce fuel ignition.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Inspection and Corrective Action

Within 30 months after the effective date of this AD: Perform a modification of the fuel pipe bracket assembly and refuel tube assembly; do all related investigative actions and applicable corrective actions; and perform an operational test of the refuel and defuel system; in accordance with paragraphs 2.B. and 2.C. of the Accomplishment Instructions of Bombardier Service Bulletin 700-28-6006, dated June 1, 2020. All related investigative and corrective actions must be done before further flight.

(h) Other FAA AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, New York ACO Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the manager of the certification office, send it to ATTN: Program Manager, Continuing Operational Safety, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7300; fax 516-794-5531. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, New York ACO Branch, FAA; or Transport Canada Civil Aviation (TCCA); or Bombardier, Inc.'s TCCA Design Approval Organization (DAO). If approved by the DAO, the approval must include the DAO-authorized signature.

(i) Related Information

(1) Refer to Mandatory Continuing Airworthiness Information (MCAI) TCCA AD CF-2020-37, dated October 9, 2020, for related information. This MCAI may be found in the AD docket on the Internet at <https://www.regulations.gov> by searching for and locating Docket No. FAA-2021-0030.

(2) For more information about this AD, contact Siddeeq Bacchus, Aerospace Engineer, Mechanical Systems and Administrative Services Section, FAA, New York ACO Branch, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; telephone 516-228-7362; fax 516-794-5531; email 9-avs-nyaco-cos@faa.gov.

(3) For service information identified in this AD, contact Bombardier, Inc., 400 Côte-Vertu Road West, Dorval, Québec H4S 1Y9, Canada; telephone 514-855-5000; fax 514-855-7401; email thd.crj@aero.bombardier.com; Internet <http://www.bombardier.com>. You may view this service information at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

Issued on February 4, 2021.

Lance T. Gant, Director,
Compliance & Airworthiness Division,
Aircraft Certification Service.

[FR Doc. 2021-03585 Filed: 2/23/2021 8:45 am; Publication Date: 2/24/2021]