



DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2025-0755; Project Identifier MCAI-2024-00633-T]

RIN 2120-AA64

Airworthiness Directives; Airbus SAS Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: The FAA proposes to supersede Airworthiness Directive (AD)

2020-06-18, which applies to all Airbus SAS Model A318 series airplanes; A319 series airplanes; A320-211, -212, -214, -216, -231, -232, -233, -251N, -252N, -253N, -271N,

-272N, and -273N airplanes; and A321 series airplanes. AD 2020-06-18 requires replacement of affected trimmable horizontal stabilizer actuators (THSAs) with

serviceable THSAs. Since the FAA issued AD 2020-06-18, a new Airbus airplane model (A321-253NY) has been certified, on which affected parts could be installed in service.

This proposed AD would continue to require the actions in AD 2020-06-18, would revise the applicability to include Model A321-253NY airplanes, and would prohibit the

installation of affected parts, as specified in a European Union Aviation Safety Agency (EASA) AD, which is proposed for incorporation by reference (IBR). The FAA is

proposing this AD to address the unsafe condition on these products.

DATES: The FAA must receive comments on this proposed AD by [INSERT DATE 45 DAYS AFTER DATE OF PUBLICATION IN THE FEDERAL REGISTER].

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- Federal eRulemaking Portal: Go to [regulations.gov](https://www.regulations.gov). Follow the instructions for submitting comments.

- Fax: 202-493-2251.

- Mail: U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- Hand Delivery: Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

AD Docket: You may examine the AD docket at [regulations.gov](https://www.regulations.gov) under Docket No. FAA-2025-0755; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the mandatory continuing airworthiness information (MCAI), any comments received, and other information. The street address for Docket Operations is listed above.

Material Incorporated by Reference:

- For EASA material identified in this proposed AD, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email ADs@easa.europa.eu. You may find this material on the EASA website at ad.easa.europa.eu. It is also available at [regulations.gov](https://www.regulations.gov) under Docket No. FAA-2025-0755.

- You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

FOR FURTHER INFORMATION CONTACT: Timothy Dowling, Aviation Safety Engineer, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone 206-231-3667; email timothy.p.dowling@faa.gov.

SUPPLEMENTARY INFORMATION:

Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments using a method listed under the ADDRESSES section. Include “Docket No. FAA-2025-0755; Project Identifier MCAI-2024-00633-T” at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to regulations.gov, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this NPRM.

Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as “PROPIN.” The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Timothy Dowling, Aviation Safety Engineer, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone 206-231-3667; email timothy.p.dowling@faa.gov. Any commentary that the

FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

Background

The FAA issued AD 2020-06-18, Amendment 39-19887 (85 FR 18428, April 2, 2020) (AD 2020-06-18), for all Airbus SAS Model A318-111, -112, -121, and -122 airplanes; Model A319-111, -112, -113, -114, -115, -131, -132, -133, -151N, -153N, and -171N airplanes; Model A320-211, -212, -214, -216, -231, -232, -233, -251N, -252N, -253N, -271N, -272N, and -273N airplanes; and Model A321-111, -112, -131, -211, -212, -213, -231, -232, -251N, -251NX, -252N, -252NX, -253N, -253NX, -271N, -271NX, -272N, and -272NX airplanes. AD 2020-06-18 was prompted by an MCAI originated by EASA, which is the Technical Agent for the Member States of the European Union. EASA issued AD 2020-0073, dated March 6, 2020 (EASA 2020-0073), to correct an unsafe condition.

AD 2020-06-18 requires replacement of affected THSAs with serviceable THSAs. The FAA issued AD 2020-06-18 to address improper installation of the THSA ball screw jack, which can compromise the failsafe design of the THSA.

Actions Since AD 2020-06-18 Was Issued

Since the FAA issued AD 2020-06-18, EASA superseded EASA AD 2020-0073 and issued EASA AD 2024-0203, dated October 22, 2024 (EASA AD 2024-0203) (also referred to as the MCAI), to correct an unsafe condition for all Airbus SAS Model A318-111, -112, -121, and -122 airplanes; Model A319-111, -112, -113, -114, -115, -131, -132, -133, -151N, -153N, and -171N airplanes; Model A320-211, -212, -214, -215, -216, -231, -232, -233, -251N, -252N, -253N, -271N, -272N, and -273N airplanes; and Model A321-111, -112, -131, -211, -212, -213, -231, -232, -251N, -251NX, -252N, -252NX, -253N, -253NX, -253NY, -271N, -271NX, -272N, and -272NX airplanes. Model A320-215 airplanes are not certificated by the FAA and are not included on the U.S. type

certificate data sheet; this proposed AD therefore does not include those airplanes in the applicability. The MCAI states a new airplane model (A321-253NY) has been certified by EASA, on which affected parts could be installed in service. EASA AD 2024-0203 extends the applicability to include Model A321-253NY airplanes and prohibits installation of affected parts on those airplanes in service.

The FAA is proposing this AD to address improper installation of the THSA ball screw jack, which can compromise the failsafe design of the THSA. The unsafe condition, if not addressed, could compromise the failsafe THSA function, possibly resulting in loss of control of the airplane. You may examine the MCAI in the AD docket at [regulations.gov](https://www.regulations.gov) under Docket No. FAA-2025-0755.

Explanation of Retained Requirements

Although this proposed AD does not explicitly restate the requirements of AD 2020-06-18, this proposed AD would retain all of the requirements of AD 2020-06-18. Those requirements are referenced in EASA AD 2024-0203, which, in turn, is referenced in paragraph (g) of this proposed AD.

Material Incorporated by Reference Under 1 CFR Part 51

EASA AD 2024-0203 specifies procedures for replacing affected THSAs with serviceable THSAs. EASA AD 2024-0203 also prohibits the installation of affected parts. This material is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section.

FAA's Determination

These products have been approved by the civil aviation authority of another country and are approved for operation in the United States. Pursuant to the FAA's bilateral agreement with this State of Design Authority, that authority has notified the FAA of the unsafe condition described in the MCAI referenced above. The FAA is

issuing this NPRM after determining that the unsafe condition described previously is likely to exist or develop in other products of the same type design.

Proposed AD Requirements in this NPRM

This proposed AD would require accomplishing the actions specified in EASA AD 2024-0203 described previously, except for any differences identified as exceptions in the regulatory text of this proposed AD.

Explanation of Required Compliance Information

In the FAA's ongoing efforts to improve the efficiency of the AD process, the FAA developed a process to use some civil aviation authority (CAA) ADs as the primary source of information for compliance with requirements for corresponding FAA ADs. The FAA has been coordinating this process with manufacturers and CAAs. As a result, the FAA proposes to incorporate EASA AD 2024-0203 by reference in the FAA final rule. This proposed AD would, therefore, require compliance with EASA AD 2024-0203 its entirety through that incorporation, except for any differences identified as exceptions in the regulatory text of this AD. Using common terms that are the same as the heading of a particular section in EASA AD 2024-0203 does not mean that operators need comply only with that section. For example, where the AD requirement refers to "all required actions and compliance times," compliance with this AD requirement is not limited to the section titled "Required Action(s) and Compliance Time(s)" in EASA AD 2024-0203. Material required by EASA AD 2024-0203 for compliance will be available at [regulations.gov](https://www.regulations.gov) under Docket No. FAA-2025-0755 after the FAA final rule is published.

Costs of Compliance

The FAA estimates that this AD, if adopted as proposed, would affect 90 airplanes of U.S. registry. For airplanes affected by AD 2020-06-18, and for any affected airplane that is imported and placed on the U.S. Register in the future, the FAA estimates the following costs to comply with this AD:

Estimated costs for required actions

Action	Labor cost	Parts cost	Cost per product	Cost on U.S. operators
Replacement	Up to 8 work-hours X \$85 per hour = Up to \$680	\$326,608	Up to \$327,288	Up to \$29,455,920

Authority for this Rulemaking

Title 49 of the United States Code specifies the FAA's authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator. Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a "significant regulatory action" under Executive Order 12866,
- (2) Would not affect intrastate aviation in Alaska, and

(3) Would not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39 - AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. The FAA amends § 39.13 by:

a. Removing Airworthiness Directive (AD) 2020-06-18, Amendment 39-19887 (85 FR 18428, April 2, 2020); and

b. Adding the following new AD:

Airbus SAS: Docket No. FAA-2025-0755; Project Identifier MCAI-2024-00633-T.

(a) Comments Due Date

The FAA must receive comments on this airworthiness directive (AD) by [INSERT DATE 45 DAYS AFTER DATE OF PUBLICATION IN THE FEDERAL REGISTER].

(b) Affected ADs

This AD replaces AD 2020-06-18, Amendment 39-19887 (85 FR 18428, April 2, 2020) (AD 2020-06-18)

(c) Applicability

This AD applies to all Airbus SAS airplanes identified in paragraphs (c)(1) through (4) of this AD, certificated in any category.

(1) Model A318-111, -112, -121, and -122 airplanes.

(2) Model A319-111, -112, -113, -114, -115, -131, -132, -133, -151N, -153N, and -171N airplanes.

(3) Model A320-211, -212, -214, -216, -231, -232, -233, -251N, -252N, -253N, -271N, -272N, and -273N airplanes.

(4) Model A321-111, -112, -131, -211, -212, -213, -231, -232, -251N, -251NX, -252N, -252NX, -253N, -253NX, -253NY, -271N, -271NX, -272N, and -272NX airplanes.

(d) Subject

Air Transport Association (ATA) of America Code 27, Flight controls.

(e) Unsafe Condition

This AD was prompted by a maintenance repair organization's report of deviations from the component maintenance manual acceptance test procedure for certain trimmable horizontal stabilizer actuators (THSAs). This AD was also prompted by a determination that affected parts could also be installed on Model A321-253NY airplanes. The FAA is issuing this AD to address improper installation of the THSA ball screw jack, which can compromise the failsafe design of the THSA. The unsafe condition, if not addressed, could result in uncontrolled movement of the horizontal stabilizer as a result of a single failure of the THSA, and consequent loss of control of the airplane.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Requirements

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, European Union Aviation Safety Agency (EASA) AD 2024-0203, dated October 22, 2024 (EASA AD 2024-0203).

(h) Exceptions to EASA AD 2024-0203

(1) Where EASA AD 2024-0203 refers to “02 April 2020 [the effective date of EASA AD 2020-0073]”, this AD requires using “April 2, 2020 (the effective date of AD 2020-26-18)”.

(2) Where EASA AD 2024-0203 refers to its effective date, this AD requires using the effective date of this AD.

(3) Where EASA AD 2024-0203 defines a serviceable part as “Any THSA, eligible for installation in accordance with Airbus instructions, which is not an affected part” this AD requires replacing that text with “Any THSA, eligible for installation, that is not an affected part”.

(4) This AD does not adopt the “Remarks” section of EASA AD 2024-0203.

(i) Additional AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, AIR-520, Continued Operational Safety Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the manager of the Continued Operational Safety Branch, send it to the attention of the person identified in paragraph (j) of this AD and email to: AMOC@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) *Contacting the Manufacturer*: For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, AIR-520, Continued Operational Safety Branch, FAA; or

EASA; or Airbus SAS's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(3) *Required for Compliance (RC)*: Except as required by paragraph (i)(2) of this AD, if any material contains procedures or tests that are identified as RC, those procedures and tests must be done to comply with this AD; any procedures or tests that are not identified as RC are recommended. Those procedures and tests that are not identified as RC may be deviated from using accepted methods in accordance with the operator's maintenance or inspection program without obtaining approval of an AMOC, provided the procedures and tests identified as RC can be done and the airplane can be put back in an airworthy condition. Any substitutions or changes to procedures or tests identified as RC require approval of an AMOC.

(j) Additional Information

For more information about this AD, contact Timothy Dowling, Aviation Safety Engineer, FAA, 2200 South 216th St., Des Moines, WA 98198; telephone 206-231-3667; email timothy.p.dowling@faa.gov.

(k) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference of the material listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this material as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) European Union Aviation Safety Agency (EASA) AD 2024-0203, dated October 22, 2024.

(ii) [Reserved]

(3) For EASA material identified in this AD, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email

ADs@easa.europa.eu; website easa.europa.eu. You may find this material on the EASA website at ad.easa.europa.eu.

(4) You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

(5) You may view this material at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, visit www.archives.gov/federal-register/cfr/ibr-locations or email fr.inspection@nara.gov.

Issued on May 8, 2025.

Peter A. White,
Deputy Director, Integrated Certificate Management Division,
Aircraft Certification Service.
[FR Doc. 2025-08399 Filed: 5/16/2025 8:45 am; Publication Date: 5/19/2025]