



DEPARTMENT OF TRANSPORTATION

Federal Aviation Administration

14 CFR Part 39

[Docket No. FAA-2025-2262; Project Identifier MCAI-2025-00083-T]

RIN 2120-AA64

Airworthiness Directives; Airworthiness Directives; ATR - GIE Avions de Transport Régional Airplanes

AGENCY: Federal Aviation Administration (FAA), DOT.

ACTION: Notice of proposed rulemaking (NPRM).

SUMMARY: The FAA proposes to adopt a new airworthiness directive (AD) for certain ATR - GIE Avions de Transport Régional Model ATR42-300, -320, -500, ATR72-201, and -212A airplanes, and for all ATR - GIE Avions de Transport Régional Model ATR72-102, -202, -211, and -212 airplanes. This proposed AD was prompted by an inspection on the ATR final assembly line that found a fire extinguishing tube, located on the ceiling of the aft cargo compartment, disconnected from its sleeve. This proposed AD would require a functional check of the aft cargo fire extinguishing system and applicable on-condition actions, if necessary. For certain airplanes, this proposed AD would also require an additional functional check and applicable on-condition actions. The FAA is proposing this AD to address the unsafe condition on these products.

DATES: The FAA must receive comments on this proposed AD by [INSERT DATE 45 DAYS AFTER DATE OF PUBLICATION IN THE FEDERAL REGISTER].

ADDRESSES: You may send comments, using the procedures found in 14 CFR 11.43 and 11.45, by any of the following methods:

- Federal eRulemaking Portal: Go to [regulations.gov](https://www.regulations.gov). Follow the instructions for submitting comments.

- Fax: 202-493-2251.

- Mail: U.S. Department of Transportation, Docket Operations, M-30, West Building Ground Floor, Room W12-140, 1200 New Jersey Avenue SE, Washington, DC 20590.

- Hand Delivery: Deliver to Mail address above between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays.

AD Docket: You may examine the AD docket at [regulations.gov](https://www.regulations.gov) under Docket No. FAA-2025-2262; or in person at Docket Operations between 9 a.m. and 5 p.m., Monday through Friday, except Federal holidays. The AD docket contains this NPRM, the mandatory continuing airworthiness information (MCAI), any comments received, and other information. The street address for Docket Operations is listed above.

Material Incorporated by Reference:

- For European Union Aviation Safety Agency (EASA) material identified in this proposed AD, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email ADs@easa.europa.eu. You may find this material on the EASA website at ad.easa.europa.eu. It is also available at [regulations.gov](https://www.regulations.gov) under Docket No. FAA-2025-2262.

- You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

FOR FURTHER INFORMATION CONTACT: Alexis Whitaker, Aviation Safety Engineer, FAA, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; phone: 516-228-7309; email: 9-AVS-AIR-BACO-COS@faa.gov.

SUPPLEMENTARY INFORMATION:

Comments Invited

The FAA invites you to send any written relevant data, views, or arguments about this proposal. Send your comments using a method listed under the ADDRESSES section. Include “Docket No. FAA-2025-2262; Project Identifier MCAI-2025-00083-T” at the beginning of your comments. The most helpful comments reference a specific portion of the proposal, explain the reason for any recommended change, and include supporting data. The FAA will consider all comments received by the closing date and may amend this proposal because of those comments.

Except for Confidential Business Information (CBI) as described in the following paragraph, and other information as described in 14 CFR 11.35, the FAA will post all comments received, without change, to regulations.gov, including any personal information you provide. The agency will also post a report summarizing each substantive verbal contact received about this NPRM.

Confidential Business Information

CBI is commercial or financial information that is both customarily and actually treated as private by its owner. Under the Freedom of Information Act (FOIA) (5 U.S.C. 552), CBI is exempt from public disclosure. If your comments responsive to this NPRM contain commercial or financial information that is customarily treated as private, that you actually treat as private, and that is relevant or responsive to this NPRM, it is important that you clearly designate the submitted comments as CBI. Please mark each page of your submission containing CBI as “PROPIN.” The FAA will treat such marked submissions as confidential under the FOIA, and they will not be placed in the public docket of this NPRM. Submissions containing CBI should be sent to Alexis Whitaker, Aviation Safety Engineer, FAA, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; phone: 516-228-7309; email: 9-AVS-AIR-BACO-COS@faa.gov. Any commentary that

the FAA receives which is not specifically designated as CBI will be placed in the public docket for this rulemaking.

Background

EASA, which is the Technical Agent for the Member States of the European Union, has issued EASA AD 2025-0080, dated April 11, 2025; corrected April 23, 2025 (EASA AD 2025-0080) (also referred to as the MCAI), to correct an unsafe condition for certain ATR - GIE Avions de Transport Régional Model ATR42-300, -320, -400, -500, ATR72-201, and -212A airplanes, and for all ATR - GIE Avions de Transport Régional Model ATR72-102, -202, -211, and -212 airplanes. Model ATR42-400 airplanes are not certificated by the FAA and are not included on the U.S. type certificate data sheet; this proposed AD therefore does not include those airplanes in the applicability. The MCAI states that during an inspection on the ATR final assembly line, a fire extinguishing tube, located on the ceiling of the aft cargo compartment, was found disconnected from its sleeve. Further investigations indicated that this condition might affect other ATR airplanes. This condition, if not detected and corrected, could affect the capability of the aft cargo compartment fire extinguishing system to contain a cargo compartment fire.

You may examine the MCAI in the AD docket at [regulations.gov](https://www.regulations.gov) under Docket No. FAA-2025-2262.

Material Incorporated by Reference Under 1 CFR Part 51

EASA AD 2025-0080 specifies procedures for accomplishing a functional check for discrepancies, such as incorrectly installed distribution piping, of the aft cargo fire-extinguishing system, and depending on the results, corrective actions. Corrective actions include correcting and re-installing the distribution piping then repeating the functional check after re-installation, or obtaining and following repair instructions from the manufacturer if a detected discrepancy cannot be corrected. For airplanes on which a functional check and corrective actions have been accomplished using certain material,

EASA AD 2025-0080 specifies performing an additional functional check and, depending on the results, corrective actions. This material is reasonably available because the interested parties have access to it through their normal course of business or by the means identified in the ADDRESSES section.

FAA's Determination

These products have been approved by the civil aviation authority of another country and are approved for operation in the United States. Pursuant to the FAA's bilateral agreement with this State of Design Authority, that authority has notified the FAA of the unsafe condition described in the MCAI referenced above. The FAA is issuing this NPRM after determining that the unsafe condition described previously is likely to exist or develop in other products of the same type design.

Proposed AD Requirements in this NPRM

This proposed AD would require accomplishing the actions specified in EASA AD 2025-0080 described previously, except for any differences identified as exceptions in the regulatory text of this proposed AD.

Explanation of Required Compliance Information

In the FAA's ongoing efforts to improve the efficiency of the AD process, the FAA developed a process to use some civil aviation authority (CAA) ADs as the primary source of information for compliance with requirements for corresponding FAA ADs. The FAA has been coordinating this process with manufacturers and CAAs. As a result, the FAA proposes to incorporate EASA AD 2025-0080 by reference in the FAA final rule. This proposed AD would, therefore, require compliance with EASA AD 2025-0080 in its entirety through that incorporation, except for any differences identified as exceptions in the regulatory text of this proposed AD. Using common terms that are the same as the heading of a particular section in EASA AD 2025-0080 does not mean that operators need to comply only with that section. For example, where the AD requirement

refers to “all required actions and compliance times,” compliance with this AD requirement is not limited to the section titled “Required Action(s) and Compliance Time(s)” in EASA AD 2025-0080. Material required by EASA AD 2025-0080 for compliance will be available at regulations.gov under Docket No. FAA-2025-2262 after the FAA final rule is published.

Costs of Compliance

The FAA estimates that this AD, if adopted as proposed, would affect 103 airplanes of U.S. registry. The FAA estimates the following costs to comply with this proposed AD:

Estimated costs for required actions

Labor cost	Parts cost	Cost per product	Cost on U.S. operators
1 work-hour X \$85 per hour = \$85	\$0	\$85	\$8,755

The FAA estimates the following costs to do any necessary on-condition actions that would be required based on the results of any required actions. The FAA has no way of determining the number of aircraft that might need these on-condition actions:

Estimated costs of on-condition actions

Labor cost	Parts cost	Cost per product
Up to 2 work-hour X \$85 per hour = \$170	\$0	Up to \$170

The FAA has received no definitive data on which to base the cost estimates for airplanes that require contacting ATR for repair instructions in order to comply with on-condition actions specified in this proposed AD.

Authority for this Rulemaking

Title 49 of the United States Code specifies the FAA’s authority to issue rules on aviation safety. Subtitle I, section 106, describes the authority of the FAA Administrator.

Subtitle VII: Aviation Programs, describes in more detail the scope of the Agency's authority.

The FAA is issuing this rulemaking under the authority described in Subtitle VII, Part A, Subpart III, Section 44701: General requirements. Under that section, Congress charges the FAA with promoting safe flight of civil aircraft in air commerce by prescribing regulations for practices, methods, and procedures the Administrator finds necessary for safety in air commerce. This regulation is within the scope of that authority because it addresses an unsafe condition that is likely to exist or develop on products identified in this rulemaking action.

Regulatory Findings

The FAA determined that this proposed AD would not have federalism implications under Executive Order 13132. This proposed AD would not have a substantial direct effect on the States, on the relationship between the national government and the States, or on the distribution of power and responsibilities among the various levels of government.

For the reasons discussed above, I certify this proposed regulation:

- (1) Is not a "significant regulatory action" under Executive Order 12866,
- (2) Would not affect intrastate aviation in Alaska, and
- (3) Would not have a significant economic impact, positive or negative, on a substantial number of small entities under the criteria of the Regulatory Flexibility Act.

List of Subjects in 14 CFR Part 39

Air transportation, Aircraft, Aviation safety, Incorporation by reference, Safety.

The Proposed Amendment

Accordingly, under the authority delegated to me by the Administrator, the FAA proposes to amend 14 CFR part 39 as follows:

PART 39 - AIRWORTHINESS DIRECTIVES

1. The authority citation for part 39 continues to read as follows:

Authority: 49 U.S.C. 106(g), 40113, 44701.

§ 39.13 [Amended]

2. The FAA amends § 39.13 by adding the following new airworthiness directive:

ATR - GIE Avions de Transport Régional: Docket No. FAA-2025-2262; Project Identifier MCAI-2025-00083-T.

(a) Comments Due Date

The FAA must receive comments on this airworthiness directive (AD) by [INSERT DATE 45 DAYS AFTER DATE OF PUBLICATION IN THE FEDERAL REGISTER].

(b) Affected ADs

None.

(c) Applicability

This AD applies to the ATR - GIE Avions de Transport Régional airplanes identified in paragraphs (c)(1) and (2) of this AD, certificated in any category, as identified in European Union Aviation Safety Agency (EASA) AD 2025-0080, dated April 11, 2025; corrected April 23, 2025 (EASA AD 2025-0080).

(1) ATR42-300, -320, and -500 airplanes.

(2) ATR72-102, -201, -202, -211, -212, and -212A airplanes.

(d) Subject

Air Transport Association (ATA) of America Code 26, Fire Protection.

(e) Unsafe Condition

This AD was prompted by an inspection on the ATR final assembly line that found a fire extinguishing tube, located on the ceiling of the aft cargo compartment, disconnected from its sleeve. The FAA is issuing this AD to address this condition, which

if not detected and corrected, could affect the capability of the aft cargo compartment fire extinguishing system to contain a cargo compartment fire.

(f) Compliance

Comply with this AD within the compliance times specified, unless already done.

(g) Requirements

Except as specified in paragraph (h) of this AD: Comply with all required actions and compliance times specified in, and in accordance with, EASA AD 2025-0080.

(h) Exceptions to EASA AD 2025-0080

(1) Where EASA AD 2025-0080 refers to its effective date, this AD requires using the effective date of this AD.

(2) Where EASA AD 2025-0080 refers to February 5, 2025 (the effective date of EASA AD 2025-0024), this AD requires using the effective date of this AD.

(3) Where EASA AD 2025-0080 refers to “any discrepancy”, this AD requires replacing that text with “any incorrectly installed distribution piping”.

(4) This AD does not adopt the “Remarks” section of EASA AD2025-0080.

(i) Special Flight Permits

Special flight permits may be issued in accordance with 14 CFR 21.197 and 21.199 to operate the airplane to a location where the airplane can be modified, provided no cargo is in the aft cargo compartment.

(j) Additional AD Provisions

The following provisions also apply to this AD:

(1) *Alternative Methods of Compliance (AMOCs)*: The Manager, International Validation Branch, FAA, has the authority to approve AMOCs for this AD, if requested using the procedures found in 14 CFR 39.19. In accordance with 14 CFR 39.19, send your request to your principal inspector or responsible Flight Standards Office, as appropriate. If sending information directly to the manager of the International Validation

Branch, send it to the attention of the person identified in paragraph (k) of this AD and email to: AMOC@faa.gov. Before using any approved AMOC, notify your appropriate principal inspector, or lacking a principal inspector, the manager of the responsible Flight Standards Office.

(2) *Contacting the Manufacturer:* For any requirement in this AD to obtain instructions from a manufacturer, the instructions must be accomplished using a method approved by the Manager, International Validation Branch, FAA; or EASA; or ATR - GIE Avions de Transport Régional's EASA Design Organization Approval (DOA). If approved by the DOA, the approval must include the DOA-authorized signature.

(k) Additional Information

For more information about this AD, contact Alexis Whitaker, Aviation Safety Engineer, FAA, 1600 Stewart Avenue, Suite 410, Westbury, NY 11590; phone: 516-228-7309; email: 9-AVS-AIR-BACO-COS@faa.gov.

(l) Material Incorporated by Reference

(1) The Director of the Federal Register approved the incorporation by reference of the material listed in this paragraph under 5 U.S.C. 552(a) and 1 CFR part 51.

(2) You must use this material as applicable to do the actions required by this AD, unless this AD specifies otherwise.

(i) European Union Aviation Safety Agency (EASA) AD 2025-0080, dated April 11, 2025; corrected April 23, 2025.

(ii) [Reserved]

(3) For EASA material identified in this AD, contact EASA, Konrad-Adenauer-Ufer 3, 50668 Cologne, Germany; telephone +49 221 8999 000; email ADs@easa.europa.eu. You may find this material on the EASA website at ad.easa.europa.eu.

(4) You may view this material at the FAA, Airworthiness Products Section, Operational Safety Branch, 2200 South 216th St., Des Moines, WA. For information on the availability of this material at the FAA, call 206-231-3195.

(5) You may view this material at the National Archives and Records Administration (NARA). For information on the availability of this material at NARA, visit www.archives.gov/federal-register/cfr/ibr-locations or email fr.inspection@nara.gov.

Issued on August 18, 2025.

Steven W. Thompson,
Acting Deputy Director, Compliance & Airworthiness Division,
Aircraft Certification Service.
[FR Doc. 2025-15999 Filed: 8/20/2025 8:45 am; Publication Date: 8/21/2025]